



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D3121-141
Job Sheet 165651



Part No: D3121-141

Job Qty: 9 ea

Part Name: Bracket Assembly



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 9/30/17

Job Tracking No:

Due Date: 10/31/17

Created By: Mario Poulin

Type: Stock

Description:

Note: DWG REV E IPP Rev:Pick:A 04.02.18 New issue KJ/DS IPP Rev:B ECN 1060 07-11-12 DD verified by: EC
IPP Rev:C New Dimensions for Blank Size 08-07-23 JLM Verified By:EC

Ship Via:

Bill of Materials

Part/Part Name	Part Note	Serial No	Quantity	Location
D3121-141 Bracket Assembly	DWG REV E IPP Rev:Pick:A 04.02.18 New issue KJ/DS IPP Rev:B ECN 1060 07-11-12 DD verified by: EC IPP Rev:C New Dimensions for Blank Size 08-07-23 JLM Verified By:EC		0.000	
D3121-21 Bolt	DWG REV E IPP A 04.02.09 New issue KJ/DS IPP Rev:B ECN 1060 07-11-12 DD verified by:EC		0.000	
D3121-241 Bearing Assembly	DWG REV E IPP Rev:A 04.02.18 New issue KJ/DS IPP Rev:B ECN 1060 07-11-12 DD verified by:EC		0.000	
M174B1.250X02.000 17-4 SS Bar 1.250 x 2.00			0.000	

Job Routing

Op No	Operation	Qty	Due Date	Standard		Workcenter/Supplier	
				Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	9 Ea	10/28/17	0.00	0.00	Start up container	K+ 17-11-10
100	Bandsaw	9 pcs	10/28/17	0.00	1.02	Bandsaw1	K+ 17-11-10
110	CNC Vertical Machining	9 pcs	10/30/17	0.47	17.65	HAAS 1	MU 17/11/11
120	QC	9 pcs	10/30/17	0.00	0.00	QC2	MU 17/11/12
130	QC	9 pcs	10/30/17	0.00	0.00	QC8	EK 17-11-16
140	Small Fab	9 pcs	10/31/17	0.00	0.26	Small Fab	DAS 38
150	QC	9 pcs	10/31/17	0.00	0.00	QC5	38
160	Packaging	9 pcs	10/31/17	0.00	0.00	Packaging3	NOV 16 2017
170	QC21-SA	9 Ea	10/31/17	0.00	0.00	QC21	NOV 16 2017

Part Op 100 - Cut blanks: (1.250" x 2.000") 6.600" long

Descriptions: 110 - 1-Machine D3121-111 as per Folio FA361 and Dwg D3121 Identify as D3121-111 3-Scribe batch number

140 - Assemble D3121-141 as per Dwg D3121.

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D3121-241 5010570 4x	9	0	0	0
140-Small Fab	D3121-21 F150589	9	0	0	0
	M174B1.250X02.000	5	0	0	0

Part Specifications

Specifications could not be found.

Dart Aerospace Ltd.

1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

DART
AEROSPACE

S008537



Bracket Assembly

D3121-141

Start up Operation

Mfg Date: 11/10/17
Job No: 165651

PART NO:
Revision:
Operation:
Change No:

Work Order ID 165651

Monday, August 28, 2017 12:40:16 PM

165651

Page 1

Item ID: D3121-141

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Bracket Assembly

Start Date: 8/14/2017 Start Qty: 9.00

9

Cust Item ID:

Required Date: 8/28/2017 Req'd Qty: 9.00

9

Customer:

Reference:

Approvals:

Process Plan:

uuDAS
21
9-89

Date: AUG 30 2017

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3121	Rev E								

100

0.00

100

BAND SAW

Bandsaw

Memo

0.67

Jeaspa Bandsaw

Cut blanks: (1.250" x 2.000") 6.600" long

110

1.22

110

HAAS CNC VERTICAL MACHINING #1

HAAS 1

Memo

4.39

HAAS CNC vertical machine #1

1-Machine D3121-111 as per Folio FA361 and Dwg D3121 Identify as D3121-1112-Deburr3-Scribe batch number

9x

Ø

uu
2017/11/11

120

QC2- Inspect parts off machine FAI/FAIB

0.00

120

QC

Memo

0.09

Quality Control

9x

Ø

uu
2017/11/11

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐			FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		
OTHER : ☐					

Monday, August 28, 2017 12:40:16 PM

Page 2

Quality Control

PLO →
one of 1a
7-11-16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 165651

Monday, August 28, 2017 12:40:16 PM

165651

Page 3

Item ID: D3121-141**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop *NS2*****Item Name:** Bracket Assembly**Start Date:** 8/14/2017 **Start Qty:** 9.00***9*****Cust Item ID:****Required Date:** 8/28/2017 **Req'd Qty:** 9.00***9*****Customer:****Reference:****Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start*****NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop*****NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

160

Identify as per dwg & Stock Location: _____

0.00

160

Packaging

Memo

0.09

Packaging

170

QC21- Final Inspection - Work Order Release

0.00

170

QC

Memo

0.90

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐			FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		
OTHER : _____					

Picklist Print

Monday, August 28, 2017 12:40:19 PM

Page 1

Work Order ID: 165651

165651

Parent Item: D3121-141

D3121-141

Parent Item Name: Bracket Assembly

Start Date: 8/14/2017

Required Date: 8/28/2017

Start Qty: 9.00

Required Qty: 9.00

Comments: IPP Rev:Pick:A04.02.18New issueKJ/DS
IPP Rev:B ECN 1060 07-11-12 DD verified by: EC
IPP Rev:C New Dimensions for Blank Size 08-07-23 JLM Verified By:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D3121-241		Manufactured	No			100	Each	43.0000	1	9			
-----------	--	--------------	----	--	--	-----	------	---------	---	---	--	--	--

D3121-241

Bearing Assembly

Location	Loc Qty	Loc Code
FG	14	
89826	4	
95927	10	
ST019	29	
164457	3	
164818	26	

D3121-21		Manufactured	No			140	Each	30.0000	1	9			
----------	--	--------------	----	--	--	-----	------	---------	---	---	--	--	--

D3121-21

Bolt

Location	Loc Qty	Loc Code
ST018	30	
150589	30	

M174B1.250X02.000		Purchased	No			140	f	11.0000	0.55	5.210526			
-------------------	--	-----------	----	--	--	-----	---	---------	------	----------	--	--	--

M174B1 250X02 000

17-4 SS Bar 1.250 x 2.00

Location	Loc Qty	Loc Code
MAT010	11	
M135933	11	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DART AEROSPACE LTD		Work Order: 165651
Description: Bracket		Part Number: D3121-111
Inspection Dwg: D3121	Rev: E	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
Ø0.392	+0.002/-0.000	.393	✓		micrometer	
0.75	+/-0.030	.750	✓		vernier	
0.375	+/-0.010	.375	✓		high gauge	
2.14	+/-0.030	2.140	✓		vernier	
1.96	+/-0.030	1.962	✓		vernier	
0.280	+/-0.010	.271	✓		vernier	
3.330	+/-0.010	3.331	✓			
3.630	+/-0.010	3.621	✓			
R0.25	+/-0.030	R0.25	✓			
R0.375	+/-0.010	R0.375	✓			
Ø0.201	+/-0.010	.1970	✓			
0.100	+/-0.010	.099	✓			
4.580	+/-0.010	4.580	✓			
6.18	+/-0.030	6.181	✓			
5.89	+/-0.030	5.888	✓			
0.080	+/-0.010	.080	✓			
0.300	+/-0.010	.303	✓			
30°	+/-0.1°	30°	✓			
R0.25	+/-0.030	R0.250	✓			
0.130	+/-0.010	.130	✓			
0.664	+/-0.010	.665	✓			
0.381	+/-0.010	.381	✓			
0.201	+/-0.010	.201	✓			
0.400	+/-0.010	.397	✓			
0.580	+/-0.010	.571	✓			
100°	+/-0.1°	100°	✓			
0.032	+0.000/-0.010	.030	✓			


Measured by: M.M.	Audited by: F.K.	Preliminary Approval:
Date: 11 novembre 2017	Date: 17-11-16	Date:

Rev	Date	Change	Revised by	Approved
A	04.01.12	New Issue P/O D3121-141	KJ/RF	
B	04.05.05	Dimensions changed/re-arranged per Dwg revision	KJ/JLM	
C	06.06.14	Dwg Rev. updated	KJ/JLM	
D	08.01.16	Dimensions updated per Dwg Rev. E	KJ/EC/DD	
E	08.05.28	Tolerance revised for Ø0.201 dimension	KJ/DD	
F	13.10.22	Tolerance revised for Ø0.201 dimension	KJ	




DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 1 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2
A	02.04.15	NEW ISSUE	
B	03.01.16	ADD RIDGES; ADD MAT'L PROP; FIX P/N ADD -141/-143/-144/-145/-146	
C	04.02.17	ADD CLEARANCE; USE -241 BEARING	
D	06.05.17	D3121-25 CAP WAS 1.024, NOW 1.000	
E	07.11.07	ADD TOLERANCE TO 0.032 (DETAIL B)	


RELEASED
07.11.07

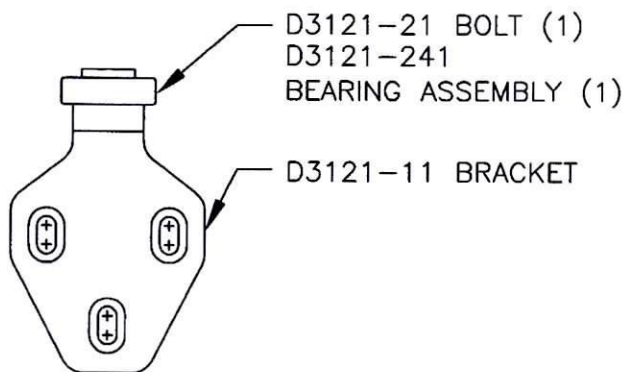

D3121-041 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-33)

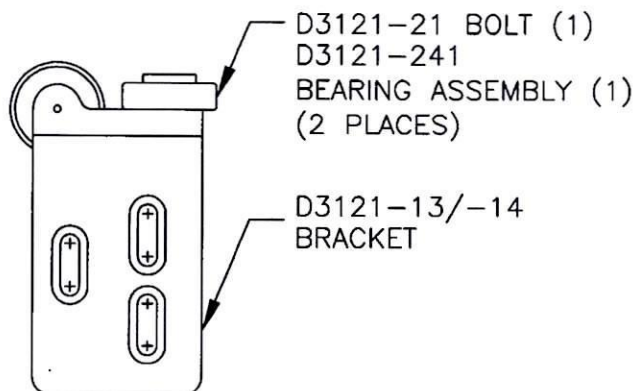

**D3121-043 (SHOWN) / D3121-044 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-37/-38)

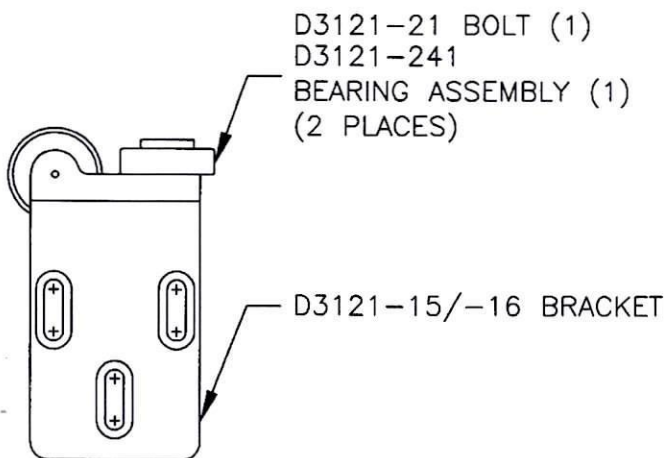

**D3121-045 (SHOWN) / D3121-046 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-35/-36)

RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 165651-
WU

AUG 30 2017

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

DART


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 2 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

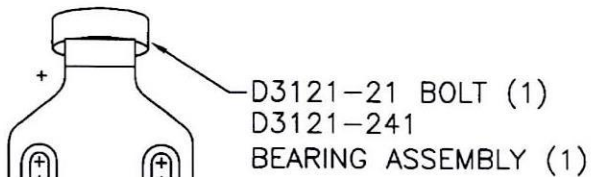


D3121-111 BRACKET

D3121-141 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23001-01)

RELEASED
07.11.07 W

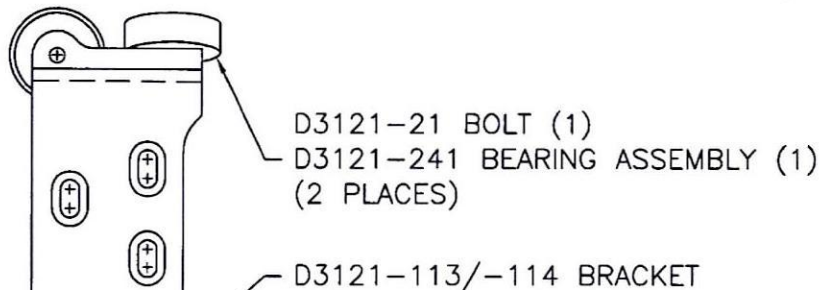

D3121-143 (SHOWN) / D3121-144 (OPPOSITE)
BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-03/-04)

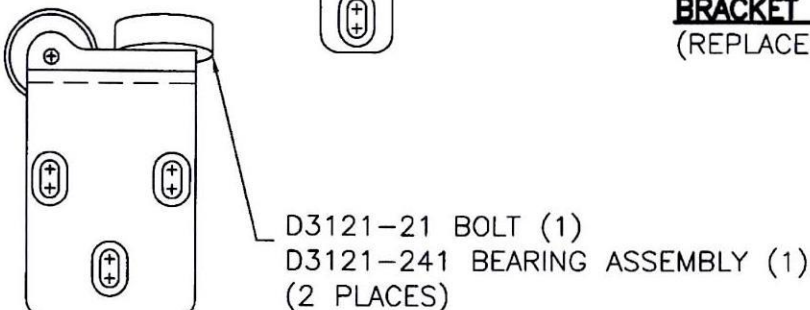

D3121-115/-116
BRACKET

D3121-145 (SHOWN) / D3121-146 (OPPOSITE)
BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-05/-06)

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 3 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1


DETAIL A:
SLOT DETAIL
SCALE 2:1
VIEW ROTATED

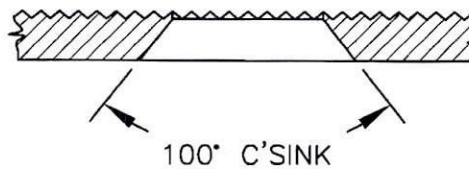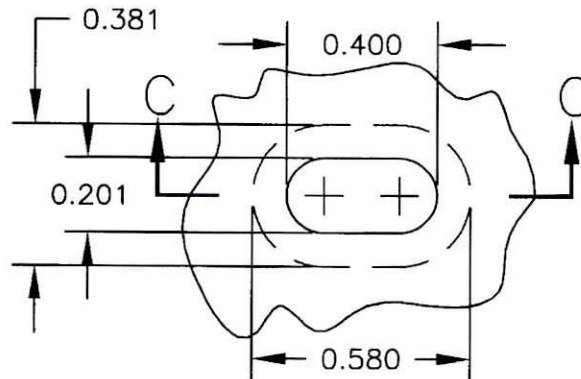

SECTION
C-C

RELEASED
07.11.07

DETAIL B:
RIDGE DETAIL
PARTIAL SECTION
SCALE 1:20

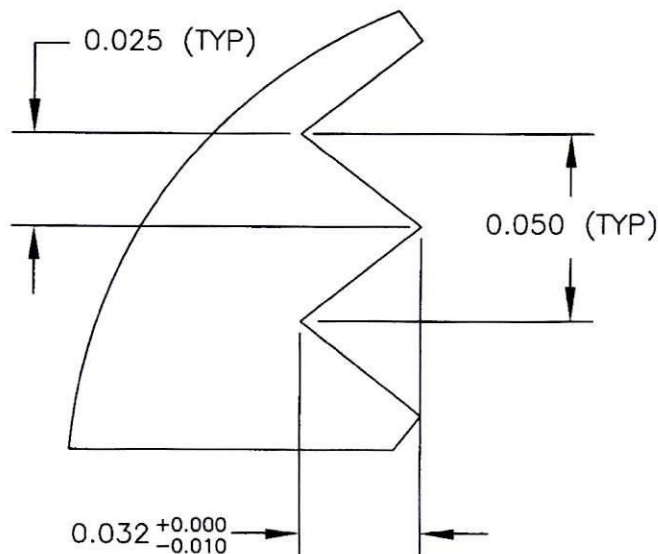

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 5 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

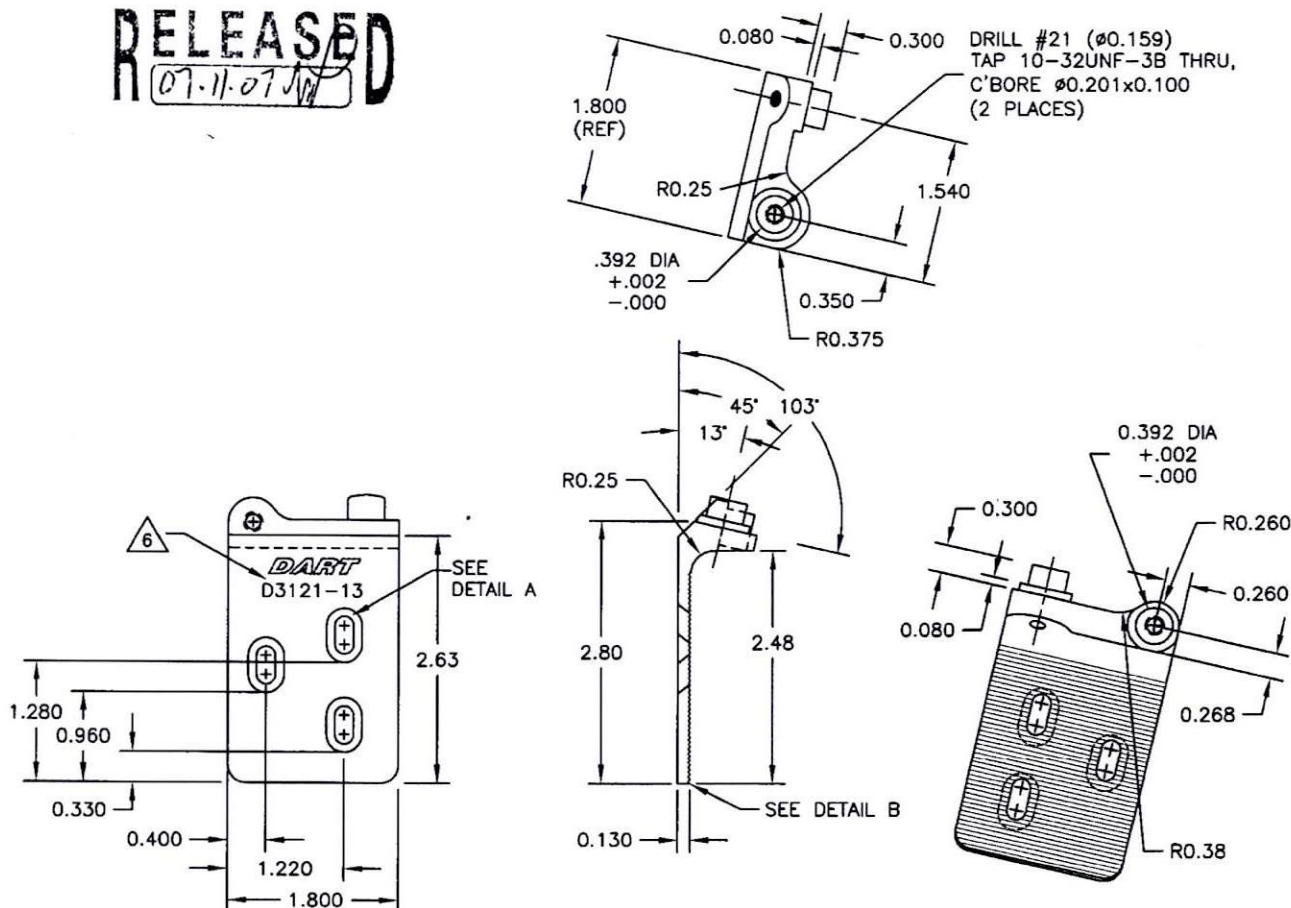

D3121-13 BRACKET (SHOWN)

D3121-14 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
- 2) MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) BRACKET DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) HONEYWELL DART P/N & LOGO AS SHOWN
HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

THIS DOCUMENT

Copyright © 2002 by DART AEROSPACE LTD

IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 6 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

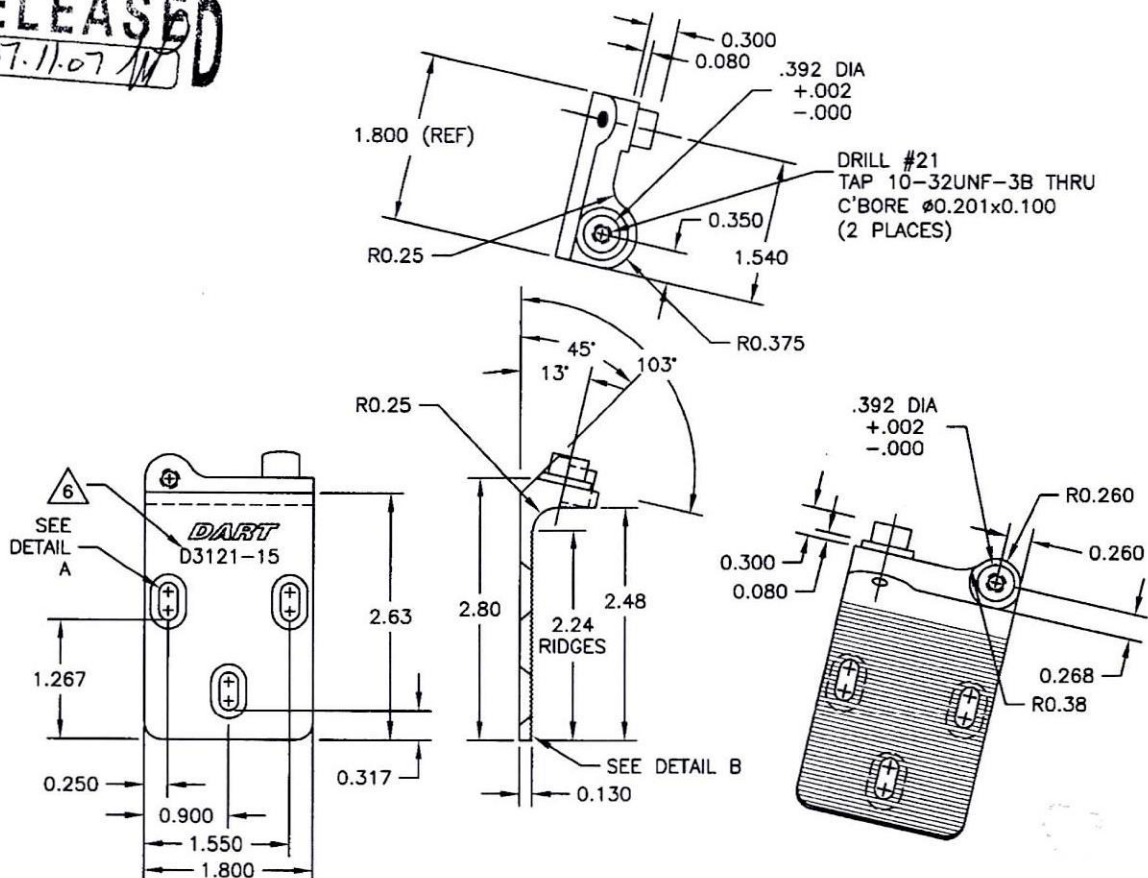RELEASED
07.11.07

D3121-15 BRACKET (SHOWN)
D3121-16 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N AND LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: <u>165651</u> Part No. <u>D3121-111</u> NCR No. _____		DISPOSITION Rework ☐ Scrap ☒ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☒</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☒	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☒	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date : <u>17-11-16</u>		Step #: <u>110</u>		QTY Effective : <u>①</u>		MRB (QSI042) Approval <u>PD 17-11-16</u>																																																																	
Description Work Order Deviation <u>.381" dimension is at .415" on one countersunk slot. Tolerance is .381 +/- .010</u> <u>Tool was not raised enough</u>				Disposition <u>scrap n destroy</u>		Completed By <u>Maime Mat</u> <u>17-11-16</u> Lead hand / Supervisor Approval Verification <u>B.A</u> <u>17-11-16</u> QC / QA Coordinator Approval <u>PD 17-11-16</u>																																																																	
Root Cause <table style="width:100%;"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> </tr> <tr> <td>Design ☒</td> <td>Operator ☒</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☒</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>				Environment ☐	No Re-verification ☐	Design ☒	Operator ☒	Doc/Data ☐	Offset/Setup ☒	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>☒ Over/Under tolerance</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	☒ Over/Under tolerance	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☒	Operator ☒																																																																						
Doc/Data ☐	Offset/Setup ☒																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	☒ Over/Under tolerance																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
OTHER : _____																																																																							



DESIGN 2 #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 7 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07/W

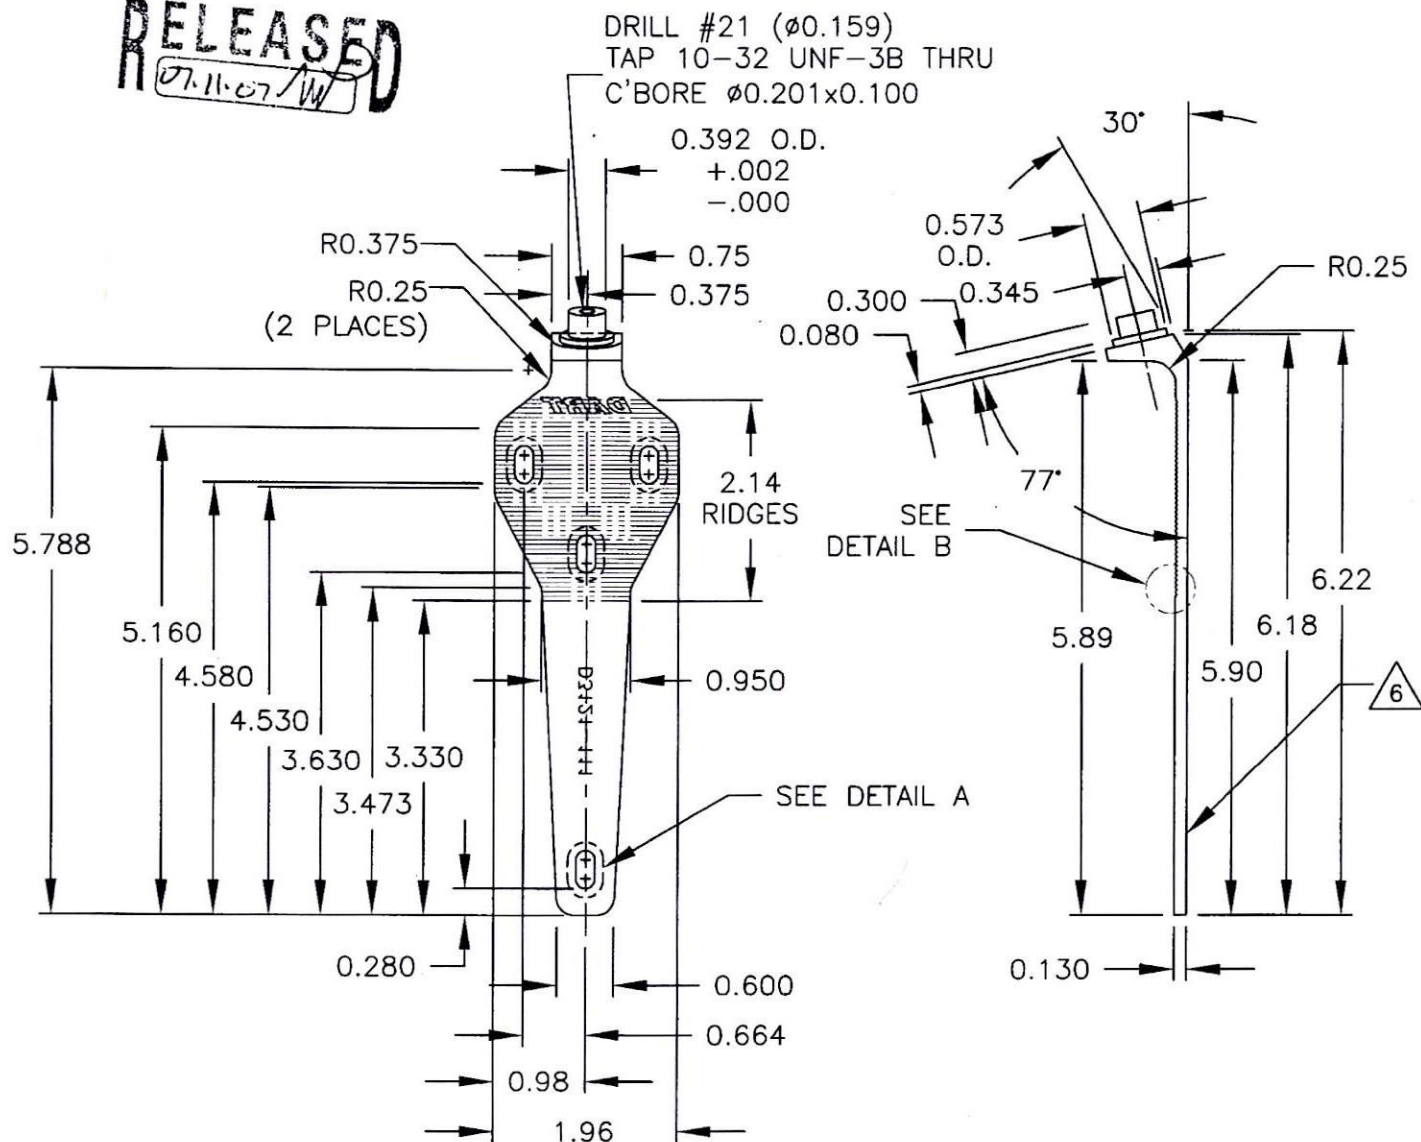

D3121-111 BRACKET

- 1) REPLACES PREMIER P/N B32-23001-11
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

DART

DESIGN <i>[Signature]</i>	DRAWN BY <i>LE</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3121	REV. E SHEET 8 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

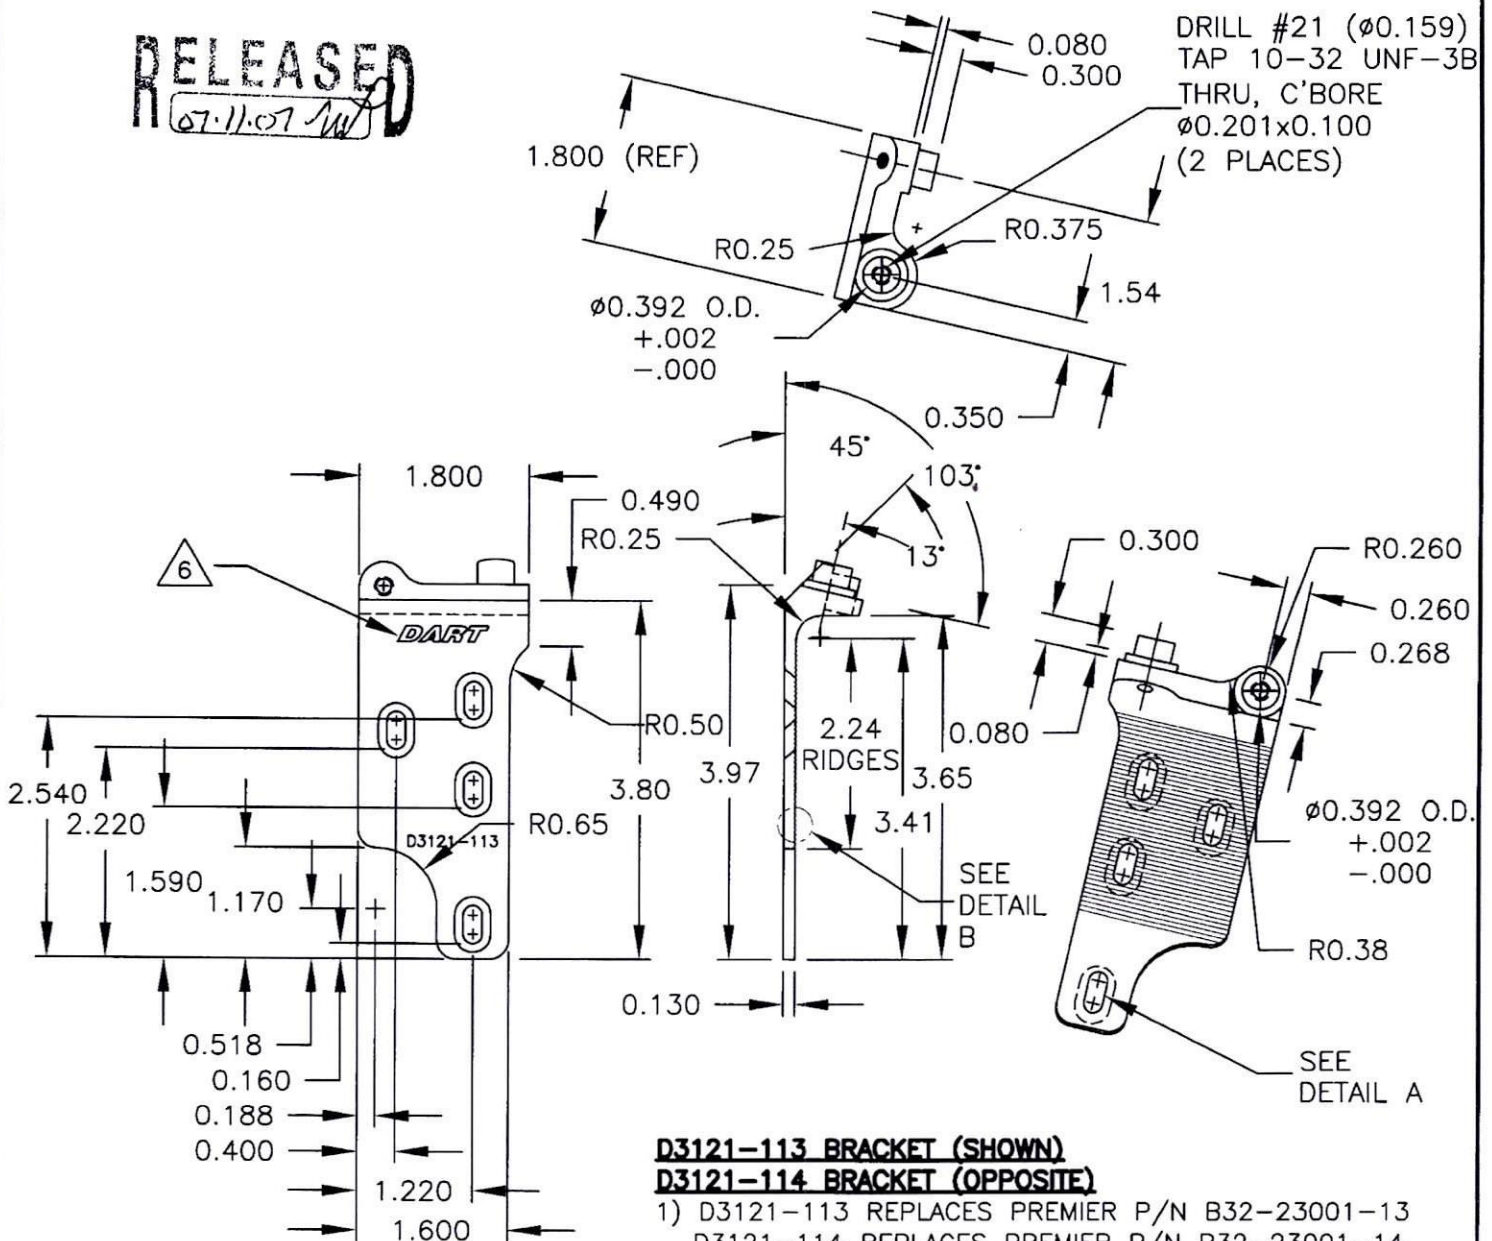RELEASED
07.11.07 *[Signature]***D3121-113 BRACKET (SHOWN)****D3121-114 BRACKET (OPPOSITE)**

- 1) D3121-113 REPLACES PREMIER P/N B32-23001-13
D3121-114 REPLACES PREMIER P/N B32-23001-14
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 9 OF 10
DATE 07.11.07	TITLE BRACKET ASSEMBLY		SCALE 1:2

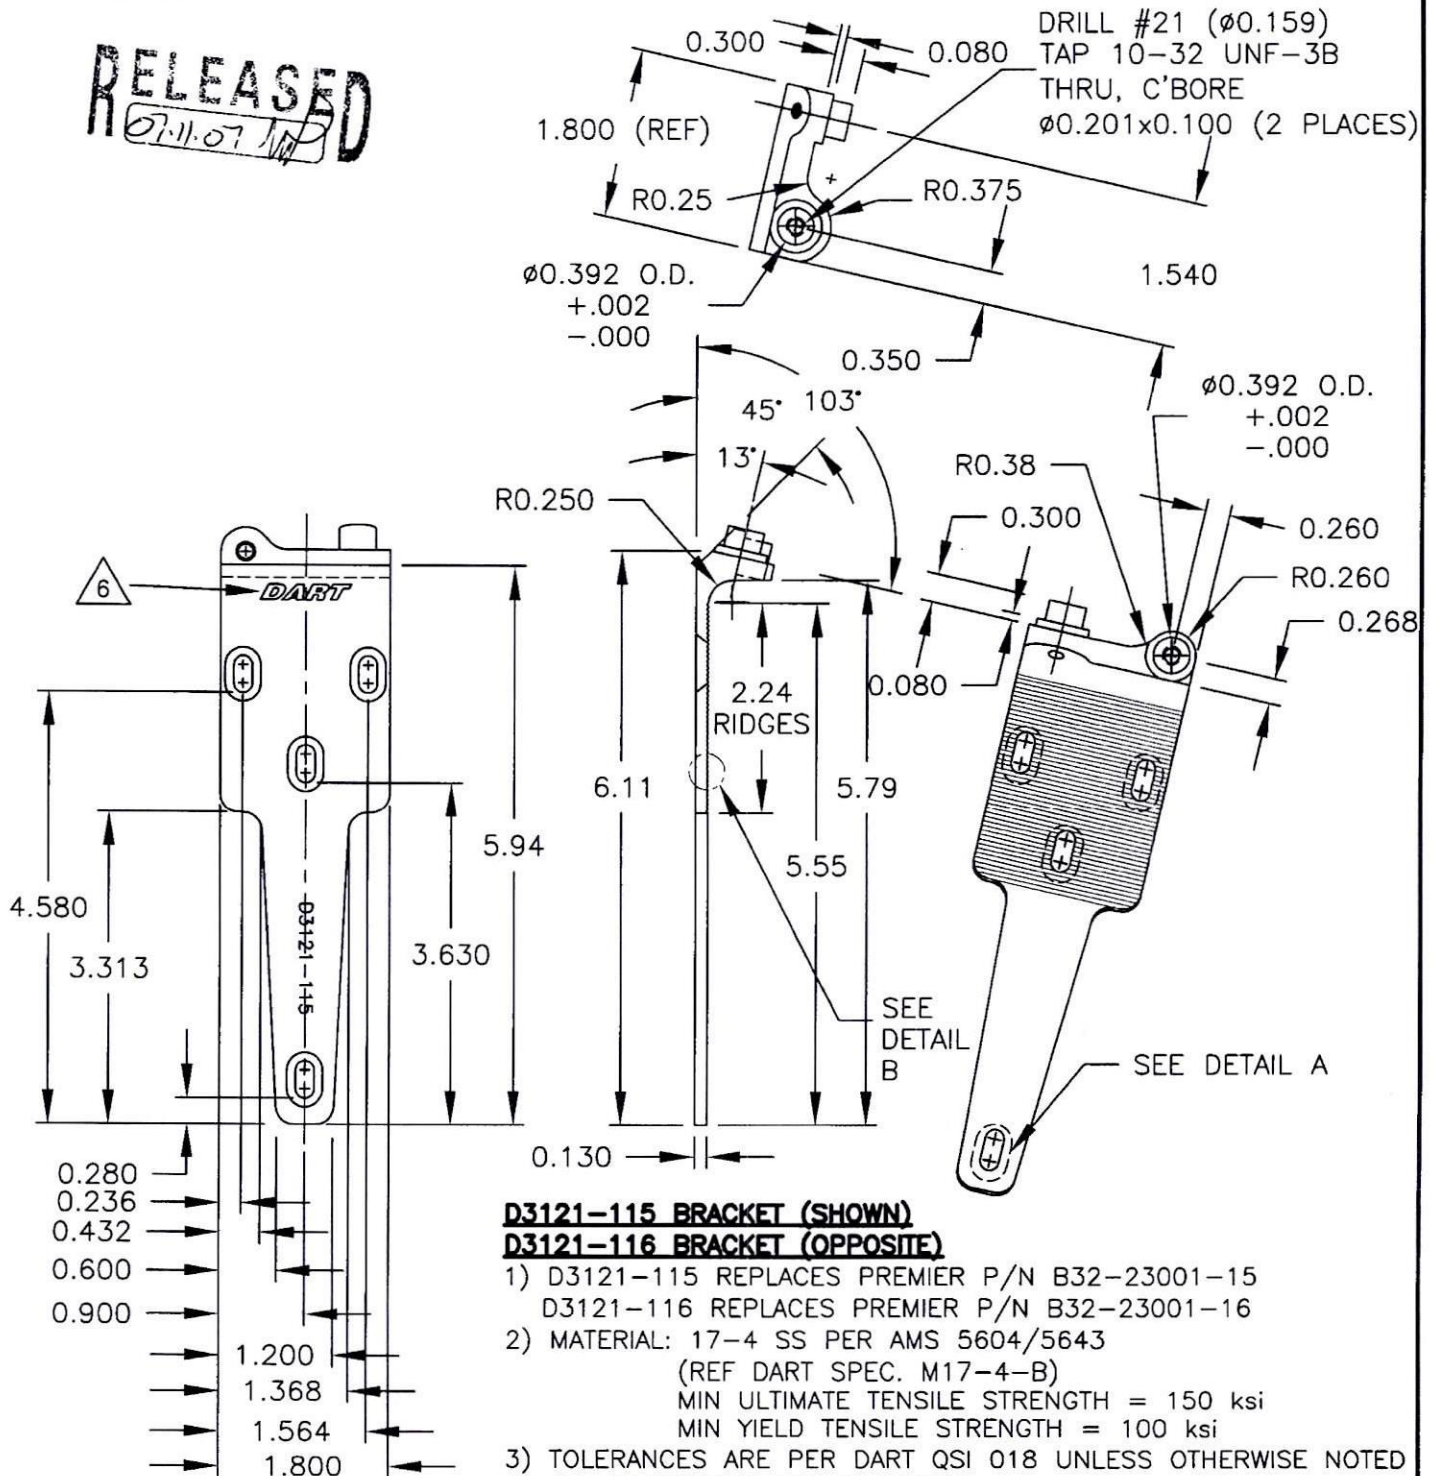RELEASED
07.11.07**D3121-115 BRACKET (SHOWN)****D3121-116 BRACKET (OPPOSITE)**

- 1) D3121-115 REPLACES PREMIER P/N B32-23001-15
D3121-116 REPLACES PREMIER P/N B32-23001-16
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DART


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 10 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1

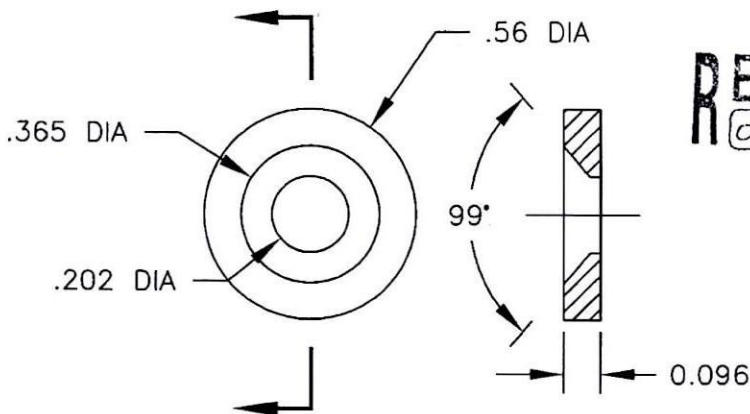**D3121-17 WASHER (SCALE 2:1)**


- 1) REPLACES PREMIER P/N B32-23001-17
- 2) MATERIAL: AISI 303 SS ROUND BAR, ANNEALED (REF DART SPEC. M303R)
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

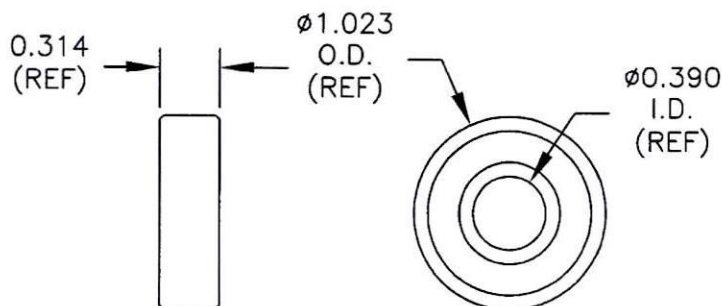**D3121-19 BEARING (SCALE 1:1)**


- 1) POSSIBLE SUPPLIER: KING BEARING P/N 6000-2ZJ/EM FAFNIR P/N 9100KDD
- 2) ALL DIMENSIONS ARE IN INCHES

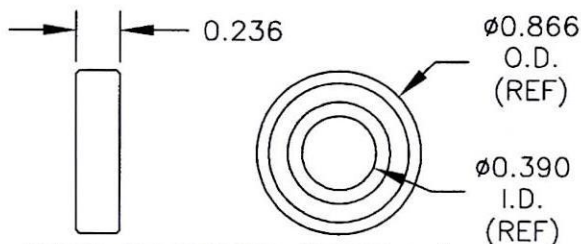**D3121-23 BEARING (SCALE 1:1)**


- 1) POSSIBLE SUPPLIER: SKF P/N 61900-2Z OR KML P/N 6900-ZZ
- 2) ALL DIMENSIONS ARE IN INCHES

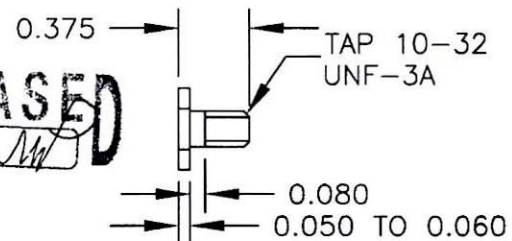**D3121-21 BOLT (SCALE 1:1)**

- 1) MATERIAL: AISI 303 SS HEX, ANNEALED (REF DART SPEC. M303H0.500)
- 2) FINISH: NONE
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

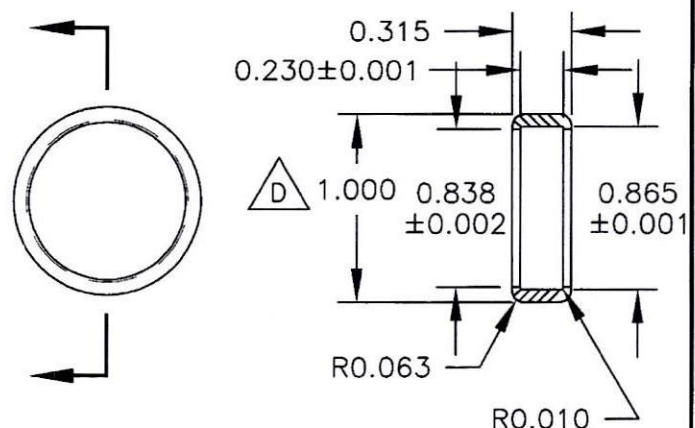**D3121-25 CAP (SCALE 1:1)**

- 1) MATERIAL: DELRIN ROD, Ø1.25 (REF DART SPEC. M-DELIN-R1.250)
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES

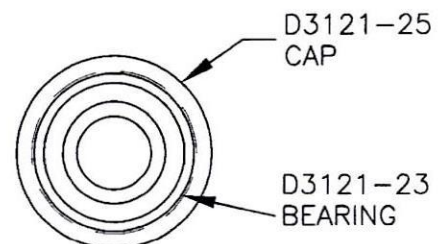**D3121-241 BEARING ASSEMBLY (SCALE 1:1)**

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					